



**NOBLES**

No. 004

EFFECTIVE DATE: 12-01-95

# TECHNICAL BULLETIN

PRODUCT(S)  
AFFECTED:

**SPR2000H SPEEDSHINE with "OHIO" motors**

SUBJECT:

**Install motor cover spacers and gaskets. (Kit #600826)**

PURPOSE:

**To prevent motor from overheating. Overheated motor may cause rectifiers to fail and/or circuit breakers to trip.**

NOTES:

This kit is available for all affected models at no charge.

To identify the Speedshines with "OHIO" motors, refer to the serial number label on the machine. Serial numbers with an "O" as the third to the last digit signifies it as an "OHIO" motor. See the list below of the serial numbers of machines affected.

There may be models from the list below that already have spacers and gaskets installed.

## Field Installation Instructions:

1. Remove pad driver.
2. Remove motor cover by removing 4 screws from underneath machine.
3. Adhere gaskets to machine as shown. Be certain to match up holes before adhering gaskets.
4. Insert four spacers into gasket holes as shown.
5. Reinstall motor cover. Use longer screws supplied with kit.
6. Replace pad driver.

## AFFECTED MODEL SERIAL NUMBERS:

SPR20H4823 OEP thru SPR20H4872 OEP  
SPR20H5147 OFP thru SPR20H5151 OFP  
SPR20H50476 OFP thru SPR20H50494 OFP  
SPR20H51832 OHP thru SPR20H51931 OHP  
SPR20H52365 OIP thru SPR20H52392 OIP  
SPR20H52590 OIP thru SPR20H52672 OIP  
SPR20H52789 OIP thru SPR20H52823 OIP  
SPR20H53310 OJP thru SPR20H53404 OJP

## SPR2000H SPEEDSHINE

