

Technical Service Bulletin

PRODUCT(S) AFFECTED: **Speed Scrub 2401/2601/2001HD, Falcon Ultra Battery and SpeedGleam Plus.**
See Affected Machine Serial Numbers below.

SUBJECT: Transaxle/Drive Motor Upgrade. More Robust, Increased reliability, Lower dBA level, less Amp draw, Better ramp climbing.

PURPOSE: Quality Improvement. For field repair, order new Transaxle/Drive Motor Replacement Kits (See details below).

NOTES: Call the Customer Service Department at 1-800-365-6625 or (616) 786-2330 to order Kits.

Model Name	Before Serial No. (date)	Volt
Falcon Ultra:	608350-101030445 (3/02)	24V
SpeedGleam Plus:	608344-10066503 (2/02)	36V
Speed Scrub 2401:	608707-10066053 (2/02)	24V
	613037-10066053 (2/02)	24V
Speed Scrub 2601:	608293-10066053 (2/02)	24V
	613038-10066053 (2/02)	24V
Speed Scrub 2001HD:	608311-10066053 (2/02)	24V
	612214-10066053 (2/02)	24V




NEW STYLE




OLD STYLE-Discontinued
630126-24V / 603450-36V

24V TRANSAXLE REPLACEMENT KIT CONTENTS #613160 (24V)

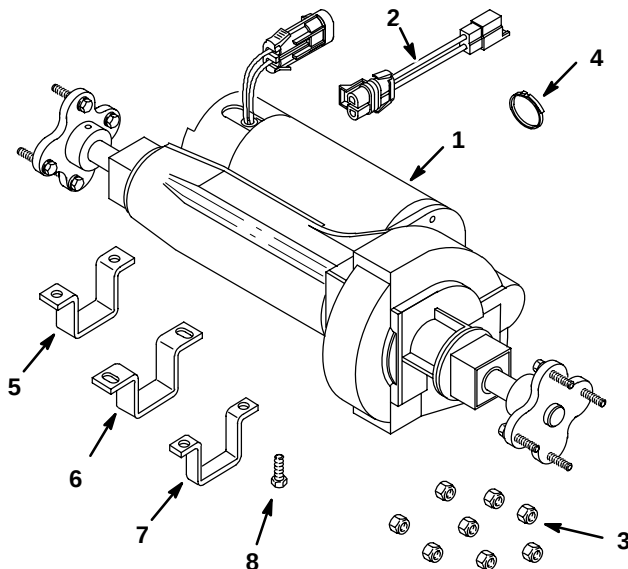

Item	P/ N.	Description	Qty.
1	612844	TRANSAXLE, 24V MOTOR, 116 RPM	1
2	612908	WIRE ADAPTER, TRANSAXLE	1
3	140501	NUT, NL 1/4-20 SS, WHEEL MOUNT	8
4	130040	TIE, WIRE 6"X.12 NYLON	2
5	606001	BRACKET, TRANSAXLE MNTG	1
6	612784	BRACKET, TRNSAXL MOUNTING	1
7	630127	BRACKET, TRANSAXLE MNTG	1
8	612255000	SCREW M10X1.5X35 HX	1

36V TRANSAXLE REPLACEMENT KIT CONTENTS #613087 (36V)

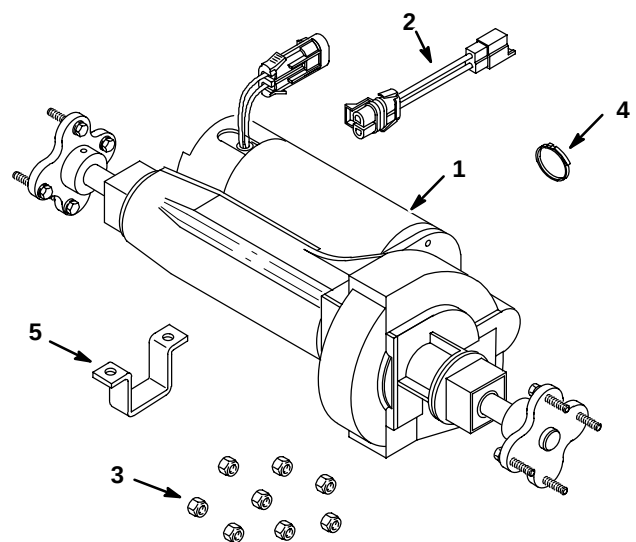

Item	P/ N.	Description	Qty.
1	612845	TRANSAXLE, 24V MOTOR, 116 RPM	1
2	612908	WIRE ADAPTER, TRANSAXLE	1
3	140501	NUT, NL 1/4-20 SS	8
4	130040	TIE, WIRE 6"X.12 NY	2
5	602881	BRACKET, TRANSAXLE MNTG	1