

Technical Service Bulletin

**MODEL(S)
AFFECTED:**

Tennant T5 ec-H2O

NA and International models manufactured before serial number 10450756 (November 5, 2009)
European models manufactured before serial number T5xxx01952 (January 5, 2010)

SUBJECT:

ec-H2O module inlet hose kinking causing a false scaling detection (*ec-H2O* system indicator light blinks red and alarm sounds).

PURPOSE:

To prevent hose from kinking, install clamp p/n 140328 as described below.

NOTES:


For questions, contact the Tennant Customer Service Department.
Warranty Information: Standard Terms Apply.



Add Clamp p/n 140328



Position clamp on inlet
hose as shown

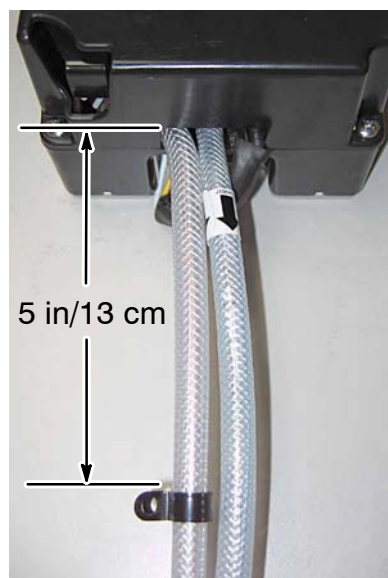

Attach clamp to Module.