

Technical Service Bulletin

MODEL(S) AFFECTED: **V-WD-24P Wet/Dry Vacuum**
Models manufactured before serial number 12443460000000437


SUBJECT: Manufacturer defect - The rod on the pump float switch may be too long which causes the pump to operate continuously when the on/off pump switch is activated. The float switch rod must swing freely without coming in contact with the bottom of the tank to properly activate pump when tank becomes full.

PURPOSE: To repair machine, slide up the rubber stop on the float switch rod and cut rod as described below. The rod is plastic and can easily be cut with cutting snips.


NOTES: **Warranty Information:** Standard warranty terms apply.

FOR SAFETY: When servicing machine, all repairs must be performed by a trained service mechanic.

1. Disconnect hose fitting to remove pump assembly from tank.
2. Position pump assembly as shown.

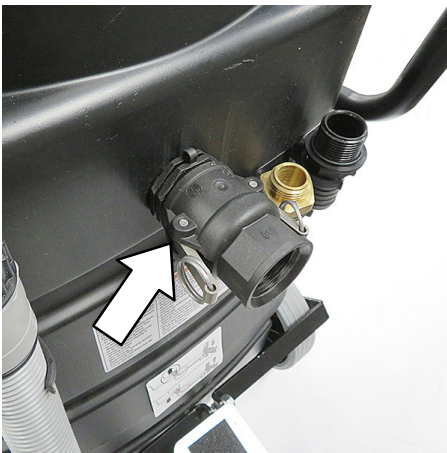

3. Measure 7.5" as described below and cut off remaining length of float switch rod as shown.

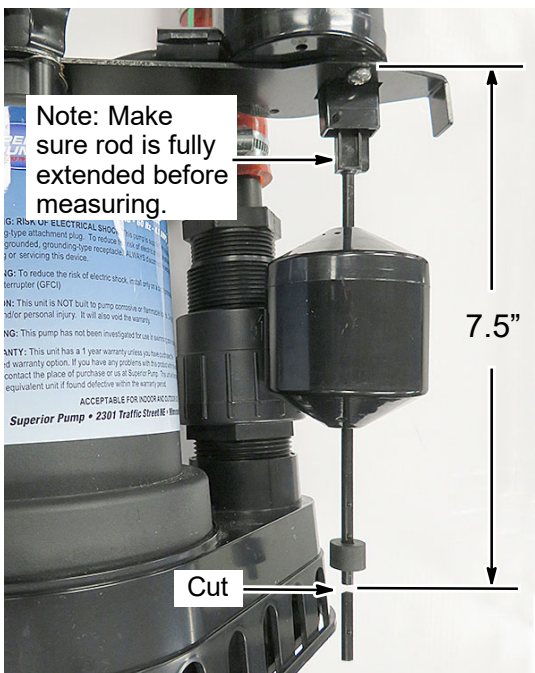

4. Reinstall pump assembly.



Model V-WD-24P