

TENNANT® TECHNICAL SERVICE BULLETIN

DATE: 910137


**TITLE:
DRIVE WHEEL ASSEMBLY**

**APPLICABLE MACHINES:
528**

SYNOPSIS:

Adding a washer to protect the wheel hub and drive motor shaft.

Machines, serial number 30279 and below, need a flat washer, TENNANT part number 32598, added behind the slotted nut on the drive motor shaft. Without the washer, the slotted nut could turn-out and damage the wheel hub and/or motor shaft.

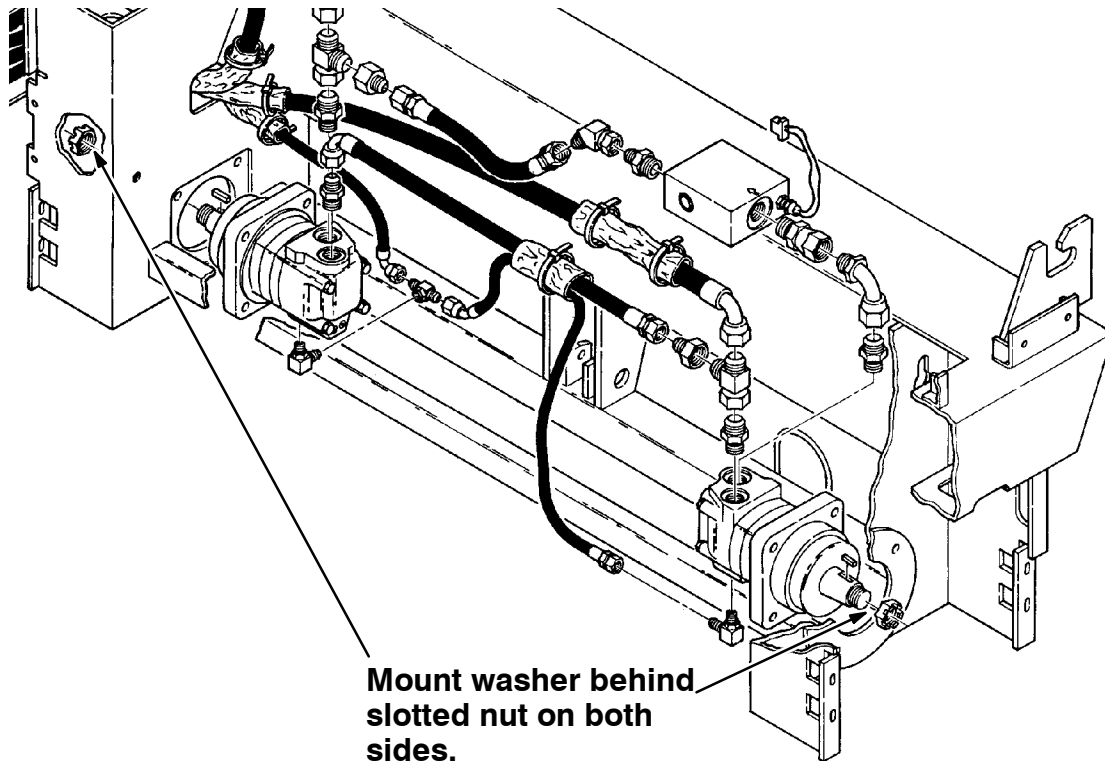

REAR WHEEL DRIVE MOTORS

04922