

# Technical Service Bulletin

**MODEL(S) AFFECTED:** Tennant 6600, 6650, 7400, 8200, and 8210 machines (equipped with GM 1.6L gasoline/LP engines)

**SUBJECT:** Replacing a 7 psi radiator cap with a 15 psi radiator cap.

**PURPOSE:** Radiator cap psi rating was increased to improve GM 1.6L engine cooling performance.

**NOTES:** Order Cap, Radiator, 15 psi (p/n 368132).  
Before installing 15 psi radiator cap, pressure test cooling system to 15 psi to ensure there are no leaks in the system.  
If servicing machine that required the cooling system to be drained for repair, refer to TSB 108 for instructions how to correctly purge air from the cooling system.  
Questions, contact the Tennant Customer Service Department at (800) 553-8033 or (763) 513-2850.

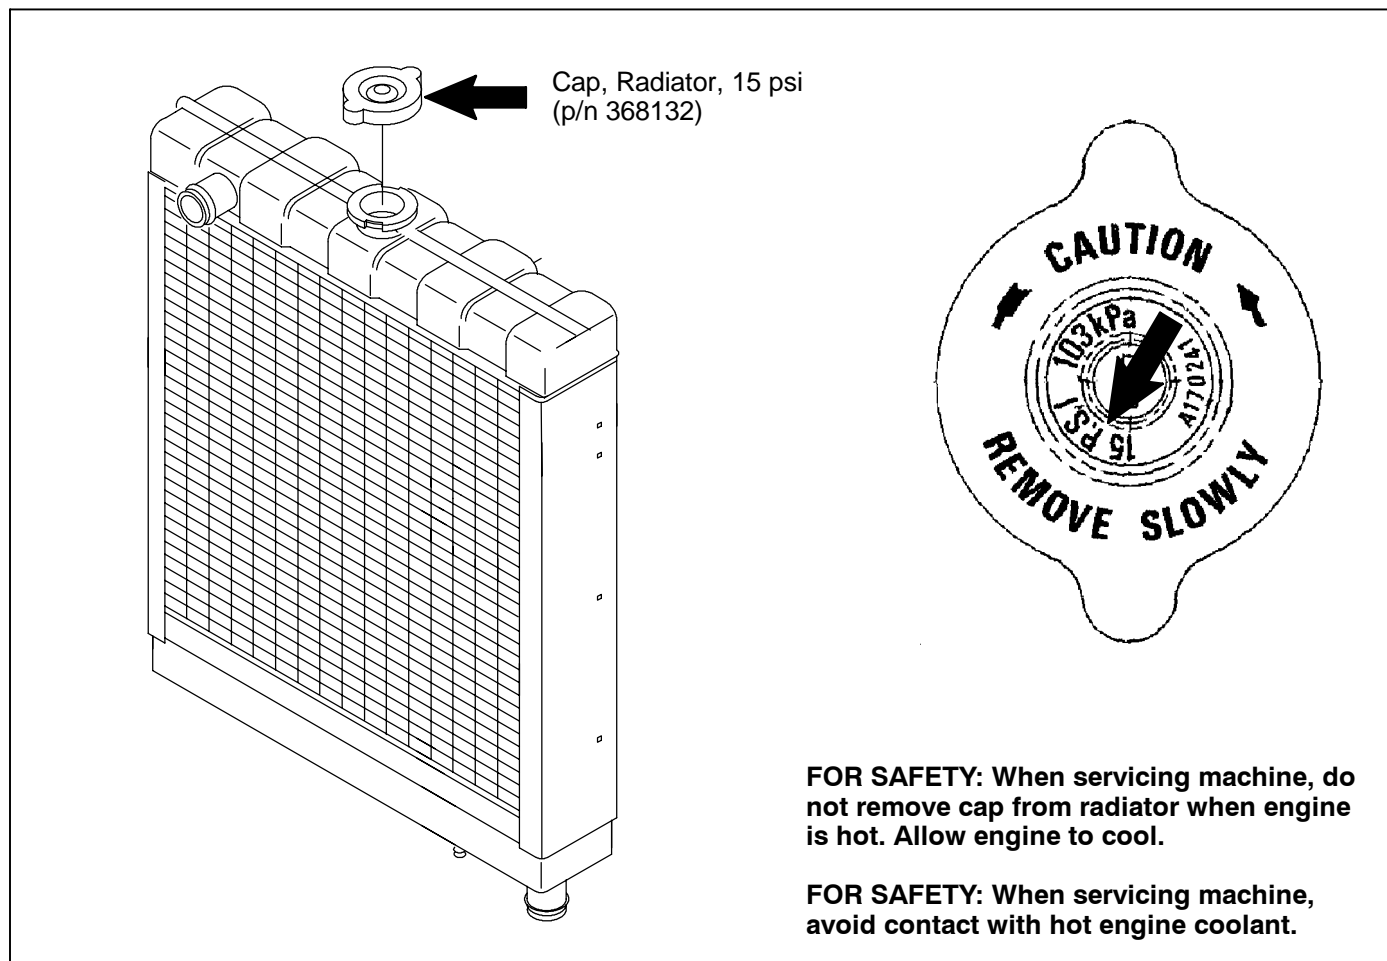


FIG. 1