

Technical Service Bulletin

MODEL(S) AFFECTED: **R3 ReadySpace® Carpet Cleaner**


Model Part Numbers: 9004192-120V, 9004199-230V

SUBJECT: Scrubhead may sporadically drip during normal operation resulting in a water spot trail on the carpet.

PURPOSE: To prevent the scrubhead from dripping, order the Foam Gasket Service Kit p/n 9006593.

NOTES: For questions, contact the Tennant Customer Service Department.
Warranty Information: Standard terms apply.

Overspray accumulation may drip off top edge of vacuum tool covers.

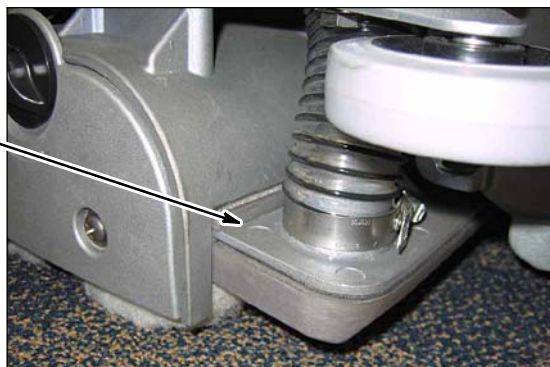

Manufacturer Note: The foam gaskets will be implemented in production in July, 2009.

Foam Gasket Service Kit (p/n 9006593) Installation Instructions:

1. Remove the two vacuum tool covers (Figure 1).
2. Thoroughly clean the top edge of each vacuum tool cover.
3. Carefully adhere the foam gasket along the top edge of the vacuum tool cover (Figure 2).
4. Press the gasket against a flat surface and roll the vacuum tool cover forward to bond the gasket (Figure 3).
5. Replace the vacuum tool covers.



Fig. 1



Fig. 2

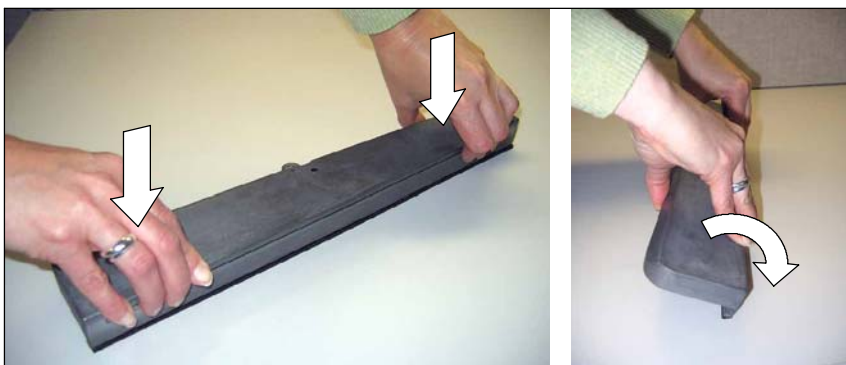


Fig. 3